General Permit No WV0115924

WEST VIRGINIA DEPARTMENT OF ENVIRONMENTAL PROTECTION WV/NPDES CONSTRUCTION STORMWATER PERMIT

FACILITY NAME:	Northport Avenue Extenison					REG.	#	EXPIRE DATE:
PERMITTEE	RANSON, CITY OF				WVR1	10191	9/11/2020	
ADDRESS/PHONE:	Attn: ANDREW P	. BLAK	E, CITY MGR					
	312 SO MILDREI	ST C						
	RANSON, WV 25438							
	3047251010							
LOCATION:	39 22 12.95 N77 52 32.83 W					Entry	Date/Time:	5/14/2020 @ 1100
COUNTY:	Jefferson			Exit D	ate/Time:	5/14/2020 @ 1130		
Site Representative				PHOT	os 🛛			
/Phone								
CO-PERMITTEE:					ADDRESS:			
SITE OPERATOR:					ADDRESS:			
PERMITTED	24.4		WEATHER:	Citi	nny	LAST		3/11/2020
ACREAGE			WEATHER.	Sui	iiiy	INSPE	CTION:	3/11/2020
RECEIVING STREAM	M(S) Rocky Marsh	l						NOV:
								W20-19-037-TDH
Regular Mail □ Certified Mail □ Tracking # 70200090000175443202								
OVERALL FACILITY RATING: Unsatisfactory COMPLIANCE OUTCOME Not Immediately Corrected								

PERMIT / SITE EVALUATION

S-Satisfactory U-Unsatisfactory	N/A	-Not Applicable N/O-Not Observed	N/D N	ot Determined M-Marginal Y-Yes N	N-No
1. PERIMETER CONTROLS	S	9. HOUSEKEEPING/SOLID WASTE	S	17. CONCRETE WASHOUT	N/O
2. DIVERSIONS/DITCH CHECKS	U	10. RECORDS, REPORTS & PLANS ON SITE	N/O	18. PUBLIC NOTICE SIGN	S
3. SEDIMENT TRAPS/BASINS	S	11. STABLE CONSTRUCTION ENTRANCE	S	19. SEDIMENT LADEN WATER LEAVING SITE	S
4. OUTLET MARKERS	U	12. MUD ON ROADWAY/DUST	S	20. CONDITIONS NOT ALLOWABLE	S
5. WASTE/BORROW SITES	U	13. APPROPRIATE BMP'S IMPLEMENTED	S	21. SWPPP/ GPP/PERMIT COMPLIANCE	S
6. OPERATIONS & MAINTENANCE	S	14. FILL SLOPE PROTECTION	S	22. ORDER COMPLIANCE	
7. WATER BARS	S	15. DEVICES INSTALLED IN TIMELY MANNER	S	23. OTHER:	
8. STABILIZATION PRACTICES	U	16 DROP INLET PROTECTION	S	24. OTHER:	

COMMENTS DEFICIENCIES AND RECOMMENDATIONS

Comments:

Walked site with Keith Allison (WVDEP).

Deficiencies:

- 1. (2) Erosion control matting (ECM) is not pinned in with accordance to plan details or manufactures recommendations. Check specification on ECM that was used to make sure it meets North American Green SC150BN as called for in plan details.
- 2. (4) Outlet marker was not posted on outlet of basin.
- **3.** (2, 5 and 8) The area around the Basin (plan sheet 11A) and soil stockpiles (plan sheet 11) has not germinated. This area appears to be inactive for more then 14 days and has not germinated within 30 days of seeding. This area needs to be reseeded in accordance with this permit.

		I was I way		
INSPECTOR:	Travis D. Hays		Telephone:	(304) 389-7642
				Modified: 10-15-2017 JHH

STATE OF WEST VIRGINIA Department of Environmental Protection Environmental Enforcement

NOTICE OF VIOLATION

Violation No W20-19-037-TDH

To the Operator or Agent of:

Facility Name: Northport Avenue Extension Permit No. WVR110191

Permittee or Individual: **RANSON, CITY OF**

Located at or near: 39 22 12.95 N, 77 52 32.83 W in Jefferson County

Representative: <u>ANDREW P. BLAKE, CITY MGR</u> Date: <u>5/14/2020</u> Time: <u>1100</u> Address / phone number: 312 SO MILDRED ST, RANSON, WV 25438 / 3047251010

Whereas, an inspection of the above named operation by the undersigned, duly authorized agent of the Secretary, at which the following described condition or practice exists, in violation of Chapter <u>22</u>, Article <u>11</u>, Section(s) <u>1 et. Seq.</u> of the Code of West Virginia and/or Section(s) <u>of the Rules and Regulations and/or Section(s) <u>Section II, III, and Appendix A</u> of the Permit referenced above promulgated thereunder in that you:</u>

<u>Have violated the following terms and conditions of WV/NPDES General Water Pollution Control Permit No.</u> WV0115924, Registration No. WVR110191:

- 1. Section II.F. RANSON, CITY OF has failed to properly implement controls in accordance with standard procedures and as described in the approved SWPPP. Erosion control matting (ECM) is not pinned in with accordance to plan details or manufactures recommendations.
- 2. Section III.A.3.- RANSON, CITY OF failed to provide interim stabilization on areas where the seed has failed to germinate adequately (uniform perennial vegetative cover with density of 70%) within 30 days after seeding and mulching must be reseeded immediately, or as soon as weather conditions allow.
- 3. <u>Appendix A.15-RANSON, CITY OF has failed to post an outlet marker at all permitted outlets from the construction site.</u> Outlet marker was not posted on outlet of basin.

The following corrective measures were discussed with you at the time of this inspection:

Take measures to correct the aforementioned violations.


Within <u>20</u> days provide a written response to the inspector named below, at the address indicated, detailing the actions taken to abate this violation.

Received by: Sent Certified Mail7020009000017544	3202	
Signature	Title	
Lear, & Clay		
Travis D. Hays		
Duly Authorized Agent / Inspector	(304) 389-7642	Travis.D.Hays@wv.gov
	Telephone	E-mail

Send Response to the Inspector at the address indicated below:

WV Department of Environmental Protection Environmental Enforcement / WW 2031 Pleasant Valley Rd., Suite #1, Fairmont, WV 26554

RANSON, CITY OF, WVR110191, Northport Avenue Extenison, 5/14/2020

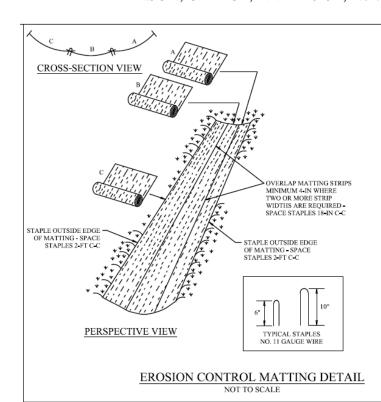

CONSTRUCTION NOTES:

- 1. EROSION CONTROL PRODUCTS FOR MATTING SHALL BE NORTH AMERICAN GREEN SC150BN OR APPROVED EQUAL. SEED AND MULCH DITCH LINE PRIOR TO PLACEMENT OF EROSION CONTROL FABRIC.
- KEY IN THE MATTING BY PLACING THE TOP ENDS OF THE MATTING IN A NARROW TRENCH, 6 IN DEPTH. BACKFILL THE TRENCH AND TAMP FIRMLY TO CONFORM TO THE CHANNEL CROSS-SECTION. SECURE WITH A ROW OF STAPLES ABOUT 4-IN DOWN SLOPE FROM THE TRENCH. SPACE THE STAPLES 6-IN CENTER TO CENTER (C-C).
- 3. STAPLE THE 4-IN OVERLAP IN THE CHANNEL CENTER USING A STAPLE SPACING OF 18-IN C-C.
- 4. BEFORE STAPLING THE OUTER EDGES OF THE MATTING, MAKE SURE THE MATTING IS SMOOTH AND IN FIRM CONTACT WITH THE SOIL.
- STAPLES SHALL BE SPACED 24-IN C-C WITH 4 ROWS FOR EACH STRIP 2 OUTER ROWS and 2 ALTERNATING ROWS DOWN THE CENTER.
- 6. WHERE ONE ROLL OF MATTING ENDS AND ANOTHER BEGINS, THE END OF THE TOP STRIP SHALL OVERLAP THE UPPER END OF THE LOWER STRIP BY 4-IN MINIMUM, USING SHIPLAP FASHION. REINFORCE THE OVERLAP WITH A DOUBLE ROW OF STAPLES SPACED 6-IN C-C IN A STAGGERED PATTERN ON EITHER SIDE.
- 7. THE DISCHARGE END OF THE MATTING LINER SHALL BE SIMILARLY SECURED WITH 2 DOUBLE ROWS OF STAPLES SPACED 6-IN C-C IN A STAGGERED PATTERN ON EITHER SIDE.
- 8. IF FLOW WILL ENTER FROM THE EDGE OF THE MATTING THEN THE AREA EFFECTED BY THE FLOW MUST BE KEYED-IN.



Erosion control matting (ECM) is not pinned in with accordance to plan details or manufactures recommendations. Check specification on ECM that was used to make sure it meets North American Green SC150BN as called for in plan details

No outlet marker posted on outlet.

RANSON, CITY OF, WVR110191, Northport Avenue Extenison, 5/14/2020



Basin area has not germinated within 30 days after seeding.



Stockpile area has not germinated within 30 days after seeding.

2. Article Number (Transfer from service label)	9590 9402 5111 9092 7982 13	CITY OF RANSON Attn: ANDREW P. BLAKE 312 SO MILDRED ST RANSON, WV 25438	1. Article Addressed to:	Attach this card to the back of the mailpiece, or on the front if space permits.	■ Complete items 1, 2, and 3. □ ■ Print your name and address on the reverse so that we can return the card to you.	SENDER: COMPLETE THIS SECTION
☐ Collect on Delivery Restricted Delivery La Signature Confirmation ☐ Insured Mail Contained Delivery ☐ Restricted Delivery ☐ Restricted Delivery	3. Service Type Adult Signature Adult Signature Adult Signature Adult Signature Certified Mall Certifie		 Ď. Is delivery address different from item 1? ☐ Yes If YES, enter delivery address below: ☐ No 	B. Represented by (Printed Name) C. Date of Delivery NO EA C. DESH 5-36-30	A. Signature X/ONN C. Michael Agent Addressee	COMPLETE THIS SECTION ON DELIVERY

PS Form 3811, July 2015 PSN /530-02-000

☐ Insured Mail Restricted Delivery

Domestic Return Receipt Restricted Delivery

